

ul. Zadziele 10, 32-406 Zakliczyn, POLAND

E-mail: support@aeroprakt.eu

Phone: +48 602 215854

AEROPRAKT

SERVICE BULLETIN

No. SB A-22-14

Repeating symbols:

Please, pay attention to the following symbols throughout this document marking important information.

- ▲ WARNING: Identifies an instruction, which if not followed may cause serious injury or even death.
- **CAUTION:** Denotes an instruction, which if not followed, may cause severe damage.
- ◆ **NOTE:** Information useful for better handling.

Release date: 22.06.2016

Effective date: 22.06.2016

Completion date:

Superseded notice: none

Model: A-22LS

Serial number(s) affected: see below

1) Planning information

1.1) Aircraft affected

Aeroprakt-22LS airplanes S/N 001-014, 016-025, 027-029, 031-037, 040-046, 049, 051-063, 065-067, 069-072, 075-084, 086-089, 093-098, 100, 101, 103-110, 113-121, 124-132, 134, 135, 137-141, 146-151, 154-157, 160-162, 164-168, 171-176, 178-182, 185-188, 190-193, 195, 196, 198, 244, 245;

1.2) Reason

Operation of A-22LS aircraft revealed that the aft control rod of the elevator is subject to wear against its supporting rollers.

1.3) Subject

Ammendment of the aircraft maintenance manual of A-22LS aircraft – inspection of the aft control rod of the elevator.

1.4) Compliance

The required ammendments were introduces into the AMM of A-22LS aircraft starting from S/N 268.

1.5) Approval

The technical content of this Service Bulletin has been approved by Aeroprakt.

1.6) Manpower

Estimated man-hours: 20-40 minutes.

1.7) Mass data

Mass change – none.

1.8) Revision of other documents

None.

1.9) Spare parts

None.

2) Spare parts information

None

ul. Zadziele 10, 32-406 Zakliczyn, POLAND

E-mail: support@aeroprakt.eu

Phone: +48 602 215854

Page 2 of 3

3) Accomplishment / Instructions

3.1) In the Aircraft Maintenance Manuals

A22LS-AMM-01 of A22LS airplanes S/N 001-014, 016-025, 027-029, 031-037, 040-046, 049, 051-063, 065-067, 069-072, 075-084, 086-089, 093-098, 100, 101, 103-110, 113-121, 124-132, 134, 135, 137-141, 149-151, 154, 157, 160, 162, 164, 165, 167, 168, 171-176, 178-182, 185-187, 190-193, 195, 196, 198;

A22LS-AMM-03 of A22LS airplanes S/N 146-148, 155, 156, 161, 166, 188, 244, 245; make ammendments in the section **11 Airplane control system** as follows:

add the following line in the **INSPECTION CHART** table:

Part No.	Description	Inspection interval	RCO	Note	
A22LS-0-5196-00	Rod, aft	500 h	OC	11.13	

add the following instruction in the **Notes** subsection:

- 11.13 Disconnect the front and rear ends of the aft rod. Lift the elevator up and take out the rod from fuselage. Inspect the area of rod contact with the supporting rollers. If the wear spot is wider than 8 mm replace the rod.
- **3.2**) In the Aircraft Maintenance Manuals A22LS-AMM-02 of A22LS airplanes S/N 199-204, 206, 208-212, 214-223, 225-243, 246-267 make ammendments in the section **12 Airplane control system** as follows:

add the following line in the **INSPECTION CHART** table:

Part No.	Description	Interval	RCO	Instruction	TM	LC
A22LS-0-5196-00	Rod, aft	500 h	OC	12.13	Г	LRI

add the following instruction in the **Notes** subsection:

12.13 Disconnect the front and rear ends of the aft rod. Lift the elevator up and take out the rod from fuselage. Inspect the area of rod contact with the supporting rollers. If the wear spot is wider than 8 mm replace the rod.

Recommended special tools: none.

Necessary parts/materials: none.

ul. Zadziele 10, 32-406 Zakliczyn, POLAND

E-mail: support@aeroprakt.eu

Phone: +48 602 215854

Page 3 of 3